



SERVICE CALL 0380 [00"H3"0]


During TR2 conversion

SERVICE CALL 0380 ON TR2 CONVERSION

We had some issues during TR2 conversion on VG Value-up!

During pump up from cleaning bath from wiper Service Call 0380 [0020] or [0030] shows up in display.

No possibility to pass, even after to go back to FW 3.10 and to start all over again.
The Service Call returns!!! We tried to do some cleanings.....without succes!

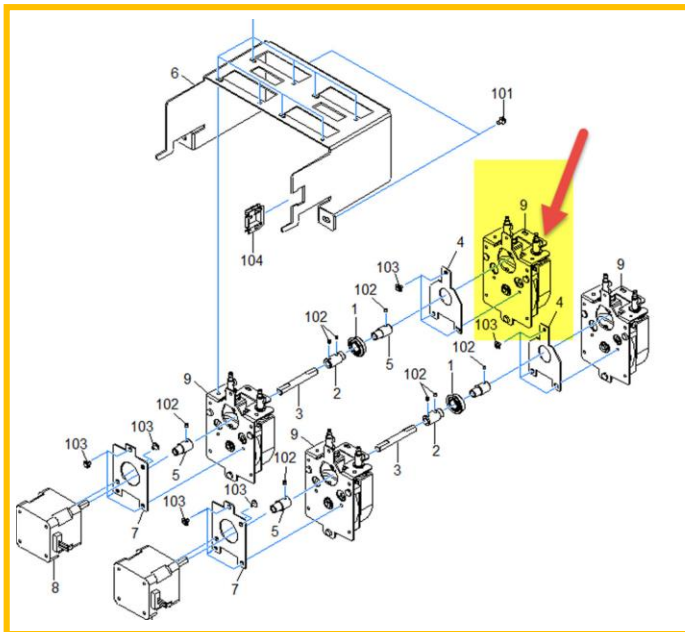

- Just by disconnecting the Captop 3 from the suction pump, you can tackle the issue.
- After you closes the “waste valve” please keep in mind to connect the Captop 3 on the Suction pump.